







#### **Model Number**

#### UC10000-F260-UE8R2

Single head system

#### **Features**


- Large sensing range
- **Adjustable Bracket**
- Programmable by means of Interface (see accessories) and SON-PROG
- 1 analog output, 0-10 V voltage source
- 2 switch outputs
- Synchronization options
- **Temperature compensation**

## **Description**

This ultrasonic sensor is a contactless distance sensor based on the echo run time principle. It is suitable for the detection of solid, liquid or powder sound-reflecting objects. The unique sensor design allows easy movement of the direction of sound radiation in all spatial directions by up to 10° without additional an additional assembly device.

## **Diagrams**

## Characteristic response curve

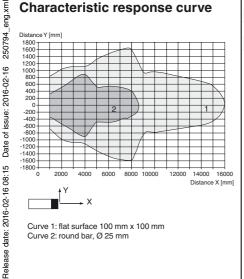

#### **Technical data**

General specifications	
Sensing range	800 10000 mm
Adjustment range	800 10000 mm
Dead band	0 800 mm
Standard target plate	100 mm x 100 mm
Transducer frequency	approx. 60 kHz

**Nominal ratings** 

Time delay before availability t 280 ms

Limit data

Permissible cable length max. 300 m

Indicators/operating means

solid: switching state switch output LED yellow flashing: misadjustment

**Electrical specifications** 

Rated operating voltage Ue 24 V DC Operating voltage U<sub>B</sub> 15 ... 30 V (including ripple)

In supply voltage interval 15 ... 20 V sensitivity reduced to

≤ 10 % Ripple No-load supply current I<sub>0</sub> < 75 mA

Input/Output

Input/output type 1 synchronization connection, bidirectional 0 Level ≤ 3 V 1 Level 15 ... 30 V typ. 0.9 k $\Omega$ Input impedance

max. 10

Number of sensors Switching output

Output type 2 switch outputs PNP, NO

Repeat accuracy R ± 15 mm

Operating current IL 300 mA, short-circuit/overload protected

Voltage drop ≤ 3 V Switch-on delay 800 ms

**Analog output** Output type 1 voltage output: 0 ... 10 V rising ramp

Default setting 800 ... 10000 mm

Linearity error ≤ 1.5 % > 2 kΩ

Load resistor

**Ambient conditions** -25 ... 70 °C (-13 ... 158 °F) Ambient temperature Storage temperature -40 ... 85 °C (-40 ... 185 °F)

Shock resistance 30 g , 11 ms period

Vibration resistance 10 ... 55 Hz , Amplitude  $\pm$  1 mm

Mechanical specifications Connection type

screw terminals, PG 13.5 cable gland **IP65** 

Degree of protection

Material Housing UP 1225 SF/R8

Transducer epoxy resin/hollow glass sphere mixture; polyurethane foam

Installation position any position

Mass 1800 g

Compliance with standards and directives

Standard conformity

Standards EN 60947-5-2:2007 + A1:2012

IEC 60947-5-2:2007 + A1:2012 EN 60947-5-7:2003 IEC 60947-5-7:2003


Approvals and certificates


UL approval cULus Listed, General Purpose CSA approval cCSAus Listed, General Purpose

CCC approval CCC approval / marking not required for products rated

Curve 2: round bar, Ø 25 mm


### **Dimensions**

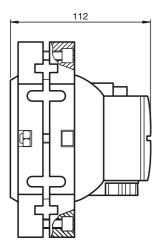

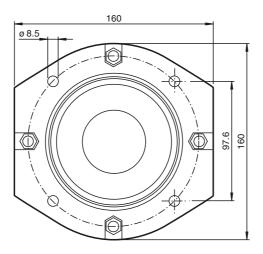


## **Additional Information**

#### **Area definitions**

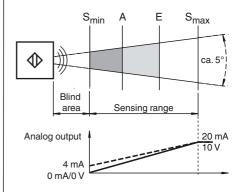

## **Electrical Connection**

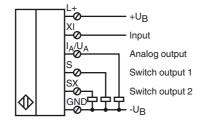

## **Accessories**

# DA5-IU-C

Digital display unit

### 3RX4000-PF

PC interface

## V15S-G-2M-PVC

Cable connector, M12, 5-pin, PVC cable

#### V1-M20-80

Receptacles, M12/M20; plastic version



#### Danger!

This product must not be used in applications in which the safety of persons depends on the device function.

This product is not a safety component in accordance with the EU Machinery Directive.


# Assembly and connection

When installing the sensor, make sure that the space filled by the sound cone is free from interfering objects. Objects in the blind zone cause cause false signals. Implement suitable measures to ensure that objects cannot enter the blind zone.

The electrical connection is made via screw terminals. The connections are protected against reverse polarity, short circuits and overloads. Shielded cables are recommended if there is electrical interference.

# Setting

The detection range limits  $S_{\text{min}}$  and  $S_{\text{max}}$  are fixed (see Technical data). Within these limits, the switch points A and E are set using a potentiometer. Switch point A must be smaller than switch point E. If this is not the case, the LED flashes and correct switching is not possible.

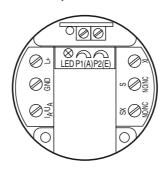

**PEPPERL+FUCHS** 

#### Parameterisation via SONPROG

The following parameters can be changed via the SONPROG parameterisation software:

- Measuring range limits S<sub>min</sub> and S<sub>max</sub>
- · Switch-on and switch-off points E and A
- Blind zone
- Averaging
- · Analogue limits
- Analogue characteristic, rising/falling

#### Operation

Within the detection range, which is restricted by the detection range limits  $S_{min}$  and  $S_{max}$ , the object distance is detected. Objects with an even, smooth surface can have a maximum inclination of 3° to the direction of sound propagation. With rough, uneven surfaces the angular deviation can be bigger. The actual value depends signficantly on the object finish and should be obtained experimentally if necessary.

## Behaviour of the switch outputs:

- If the object is at a distance > E, both switch outputs are in standby mode.
- If the object is between E and A, switch output S is activated and switch output SX is in standby mode.
- If the object is at a distance < A, switch output SX is activated and switch output S is in standby mode.

#### Behaviour of the analogue output:

The object distance between the detection range limits  $(S_{min}, S_{max})$  are displayed in the form of an analogue output signal at the analogue output. The analogue output delivers its minimum value at distance  $S_{min}$  and its maximum value at distance  $S_{max}$ . The characteristic between the two measuring range limits is linear. Outside of  $S_{max}$  the analogue output retains its maximum value.

#### Display:

The sensor has an LED. It lights up continuously when the output terminal S is carrying a voltage. It flashes when switch points A and E are set incorrectly (see Setting).

#### **Function input XI**

The sensor is placed in standby mode by connecting a low level at the function input XI (blocked release). The sensors then performs no measurements. The switch outputs retain the most recent status. As soon as function input XI is disconnected from the low level or a high level is connected (release), the sensor resumes its normal function after the release period has expired.

The function input XI can be used during operation for the synchronisation of multiple sensors in the event of mutual interefence. The following synchronisation modes are possible:

- Triggering of each individual sensor with a separate control signal, e.g. by a PLC (external synchronisation).
- Connection of the function inputs XI of all sensors and joint triggering with an external control signal, e.g. by a PLC (external synchronisation, common-mode operation).
- Connection of the function inputs XI of all sensors and without triggering with an external signal (internal synchronisation, multiplex mode).


#### Maintenance

The ultrasonic sensor is maintenance-free. However, the converter surface must not be wet, damaged, painted or covered with material deposits..

## Connecting the PC interface 3RX4000-PF to use SONPROG

This sensor can be parameterised using SONPROG for an optimum adaptation to the application. Therefore the sensor provides communication with the 3RX4000-PF PC interface. To connect to the 3RX4000-PF PC interface a 4- or 5-pin M12 male cable connector is reqired. We recommend e. g. an adapter V1-M20-80 or a cable connector V15S-G-2M-PVC.

Please connect the wires to the sensors terminals as shown, below.

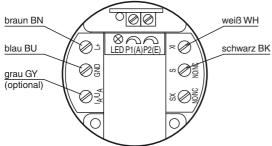

The terminals I<sub>A</sub>/U<sub>A</sub> (analog output) and SX (2<sup>nd</sup> switching output) are not needed for programming.