Technical Information Cerabar PMC11, PMC21, PMP11, PMP21

Process pressure measurement



Pressure transducer with ceramic and metal sensors

Application

The Cerabar is a pressure transducer for the measurement of absolute and gauge pressure in gases, vapors, liquids and dust. The Cerabar can be used internationally thanks to a wide range of approvals and process connections.

Your benefits

- High reproducibility and long-term stability
- Reference accuracy: up to 0.3%
- Customized measuring ranges
 - Turn down up to 5:1
 - Sensor for measuring ranges up to 400 bar (6000 psi)
- Housing and process isolating diaphragm made of 316L





Table of contents

Document information	4 4 5 6
Function and system design Measuring principle - process pressure measurement Measuring system Device features Product design System integration	8 . 8
Input	13 13 13
Output . Output signal . Signal range 4 to 20 mA . Load (for 4 to 20 mA devices) . Load resistance (for 0 to 10 V devices) . Signal on alarm 4 to 20 mA . Dead time, time constant . Dynamic behavior .	16 16 16 16 16 16 16
Power supply	 18 18 18 19 19 19 19 19 19 19 19
Performance characteristics of ceramic process isolating diaphragm	20 20 20 20 20 20 20 21 21
Performance characteristics of metal process isolating diaphragm	22 22 22

Influence of the installation position22Resolution22

Reference accuracy	22 22 22 22
InstallationInstallation conditionsInfluence of the installation positionMounting locationMounting instructions for oxygen applications	23 23 23 23 24
Environment	26 26 26 26 26 26 26
Process Process temperature range for devices with ceramic process isolating diaphragm Process temperature range for devices with metallic process isolating diaphragm Pressure specifications	27 27 27 28
Mechanical constructionDesign, dimensionsElectrical connectionHousingProcess connections with internal, ceramic processisolating diaphragmProcess connections with internal, metal process isolatingdiaphragmProcess connections with internal, metal process isolatingdiaphragmMaterials in contact with processMaterials not in contact with processCleaningCleaning	29 29 30 32 33 34 34 35 36 37 37 37 38 39 40 41
Operability	42 42
Certificates and approvals	43 43

RoHSRCM-Tick markingEAC conformityApprovalApprovalSafety Instructions (XA)Marine approval (pending)Pressure Equipment Directive 2014/68/EU (PED)Other standards and guidelinesCRN approvalCalibration unitCalibration certificates	43 43 43 43 43 44 44 44 45 45 45 45
Ordering information	46 46
Accessories .	47
Weld-in adapter	47
Plug-on display PHX20	47
M12 plug connectors	47
Documentation	48
Field of Activities	48
Technical Information	48

Operating Instructions48Brief Operating Instructions48Safety Instructions (XA)48

Document information

Document function

The document contains all the technical data on the device and provides an overview of the accessories and other products that can be ordered for the device.

Symbols used

Safety symbols

Symbol	Meaning
A DANGER	DANGER! This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.
WARNING	WARNING! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.
A CAUTION	CAUTION! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.
NOTICE	NOTICE! This symbol contains information on procedures and other facts which do not result in personal injury.

Electrical symbols

Symbol	Meaning	Symbol	Meaning
	Protective ground connection A terminal which must be connected to ground prior to establishing any other connections.	<u> </u>	Ground connection A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system.

Symbols for certain types of information

Symbol	Meaning
	Permitted Procedures, processes or actions that are permitted.
\mathbf{X}	Forbidden Procedures, processes or actions that are forbidden.
i	Tip Indicates additional information.
	Reference to documentation
	Reference to page
	Reference to graphic
	Visual inspection

Symbols in graphics

Symbol	Meaning
1, 2, 3	Item numbers
1. , 2. , 3	Series of steps
A, B, C,	Views

E

Documentation

The document types listed are available:

In the Download Area of the Endress+Hauser Internet site: www.endress.com \rightarrow Download

Brief Operating Instructions (KA): getting the 1st measured value quickly

These instructions contain all the essential information from incoming acceptance to initial commissioning.

Operating Instructions (BA): your comprehensive reference

These Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

Safety Instructions (XA)

Depending on the approval, the following Safety Instructions (XA) are supplied with the device. They are an integral part of the Operating Instructions.

Device	Directive	Documentation	Option 1)
PMP21	ATEX II 1/2G Ex ia IIC T4 Ga/Gb	XA01271P	BA
PMC21	ATEX II 2G Ex ia IIC T4 Gb	XA01271P	BB
PMC21 PMP21	ATEX II 3G Ex ec IIC T4 Gc	XA01533P	BC
PMC21 PMP21	FM IS Cl. I, Div.1 Gr. A-D T4	XA01321P	FA
PMC21 PMP21	CSA C/US IS Cl. I Div. 1 Gr. A-D	XA01322P	CB
PMC21 PMP21	EAC Ex ia IIC T4 Ga/Gb	XA01540P	GA
PMC21 PMP21	IEC Ex ia IIC T4 Ga/Gb	XA01271P	IA
PMC21 PMP21	NEPSI Ex ia IIC T4	XA01363P	NA
PMC21 PMP21	TIIS Ex ia IIC T4	In preparation	ТА

1) Product Configurator order code for "Approval"

The nameplate indicates the Safety Instructions (XA) that are relevant to the device.


A0029505

Terms and abbreviations

Term/ Item Explanation abbreviation OPL 1 The OPL (over pressure limit = sensor overload limit) for the measuring device depends on the lowest-rated element, with regard to pressure, of the selected components, i.e. the process connection has to be taken into consideration in addition to the measuring cell. Also observe pressure-temperature dependency. For the relevant standards and additional notes, see the "Pressure specifications" section → 🖹 28. The OPL may only be applied for a limited period of time. 2 MWP The MWP (maximum working pressure) for the sensors depends on the lowestrated element, with regard to pressure, of the selected components, i.e. the process connection has to be taken into consideration in addition to the measuring cell. Also observe pressure-temperature dependency. For the relevant standards and additional notes, see the "Pressure specifications" section \rightarrow 🗎 28 . The MWP may be applied at the device for an unlimited period. The MWP can also be found on the nameplate. 3 Maximum sensor Span between LRL and URL This sensor measuring range is equivalent to the maximum calibratable/adjustable measuring range span. 4 Calibrated/ Span between LRV and URV Factory setting: 0 to URL adjusted span Other calibrated spans can be ordered as customized spans. Pressure р LRL Lower range limit URL Upper range limit LRV Lower range value URV Upper range value TD (turn down) Turn down The turn down is preset at the factory and cannot be changed. Example - see the following section.

Endress+Hauser

Turn down calculation

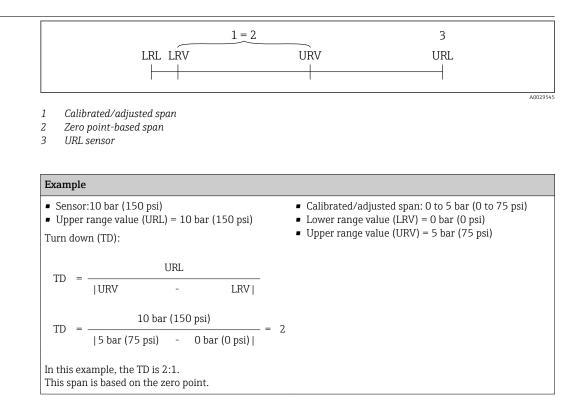

Function and system design

Devices with ceramic process isolating diaphragm (Ceraphire®)

The ceramic sensor is an oil-free sensor, i.e. the process pressure acts directly on the robust ceramic process isolating diaphragm and causes it to deflect. A pressure-dependent change in capacitance is measured at the electrodes of the ceramic substrate and the process isolating diaphragm. The measuring range is determined by the thickness of the ceramic process isolating diaphragm.


Advantages:

Measuring principle -

process pressure

measurement

- Guaranteed overload resistance up to 40 times the nominal pressure
- The ultrapure 99.9% ceramic (Ceraphire[®], see also "www.endress.com/ceraphire") ensures:
 Extremely high chemical durability
 - High mechanical durability
- Can be used in absolute vacuum
- Small measuring ranges

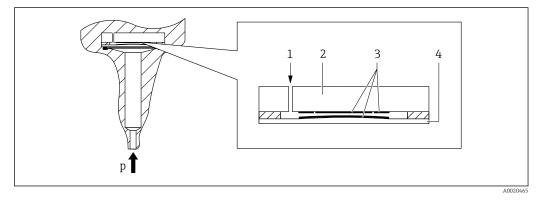


- 1 Air pressure (gauge pressure sensors)
- 2 Ceramic substrate
- 3 Electrodes
- 4 Ceramic process isolating diaphragm

Devices with metallic process isolating diaphragm

The process pressure deflects the metal process isolating diaphragm of the sensor and a fill fluid transfers the pressure to a Wheatstone bridge (semiconductor technology). The pressure-dependent change in the bridge output voltage is measured and evaluated.

Advantages:


- Can be used for high process pressures
- Fully welded sensor
- Slim, flush-mounted process connections available

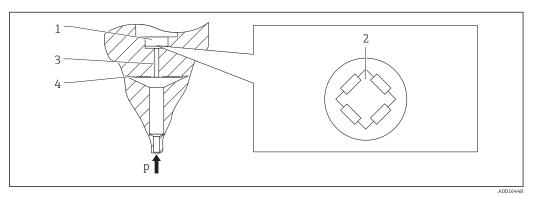

- 1 Silicon measuring element, substrate
- 2 Wheatstone bridge
- 3 Channel with fill fluid
- 4 Metal process isolating diaphragm

Measuring system

A complete measuring system comprises:

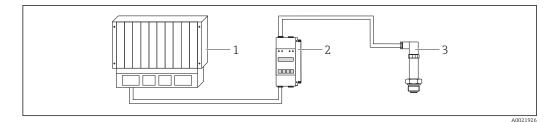

1 PLC (programmable logic control)

2 e.g. RN221N / RMA42 (if required)

3 Pressure transducer

Device features

Field of application

- PMC11: Gauge pressure
- PMP11: Gauge pressure
- PMC21: Gauge and absolute pressure
- PMP21: Gauge and absolute pressure

Process connections

PMC11:

- Thread ISO 228
- Thread ASME
- DIN 13

PMP11:

- Thread ISO 228, also flush-mount
- Thread ASME
- DIN 13
- PMC21:
- Thread ISO 228
- Thread DIN 13
- Thread ASME
- Thread JIS

PMP21:

- Thread ISO 228, also flush-mount
- Thread DIN 13
- Thread ASME
- Thread JIS

Measuring ranges

- PMC11: from -400 to +400 mbar (-6 to +6 psi) to -1 to +40 bar (-15 to +600 psi).
- PMP11: from -400 to +400 mbar (-6 to +6 psi) to -1 to +40 bar (-15 to +600 psi).
- PMC21: from -100 to +100 mbar (-1.5 to +1.5 psi) to -1 to +40 bar (-15 to +600 psi).
- PMP21: from -400 to +400 mbar (-6 to +6 psi) to -1 to +400 bar (-15 to +6000 psi).

OPL (depends on the measuring range)

- PMC11: max. 0 to +60 bar (0 to +900 psi)
- PMP11: max. 0 to +160 bar (0 to +2 400 psi)
- PMC21: max. 0 to +60 bar (0 to +900 psi)
- PMP21: max. 0 to +600 bar (0 to +9000 psi)

MWP

- PMC11: max. 0 to +60 bar (0 to +900 psi)
- PMP11: max. 0 to +160 bar (0 to +2 400 psi)
- PMP21: max. 0 to +600 bar (0 to +9000 psi)
- PMC21: max. 0 to +60 bar (0 to +900 psi)

Process temperature range (temperature at process connection)

- PMC11: -25 to +85 °C (-13 to +185 °F)
- PMP11: -25 to +85 °C (-13 to +185 °F)
- PMC21: -25 to +100 °C (-13 to +212 °F)
- PMP21: -40 to +100 °C (-40 to +212 °F)

Ambient temperature range

PMC11: -40 to +70 °C (-40 to +158 °F)

PMP11: -40 to +70 °C (-40 to +158 °F)

PMC21:

■ -40 to +85 °C (-40 to +185 °F)

Devices for hazardous areas: -40 to +70 °C (-40 to +158 °F)

PMP21:

-40 to +85 °C (-40 to +185 °F)

Reference accuracy

- PMC11: up to 0.5 %, TD 5:1, for details, see "Reference accuracy" section.
- PMP11: up to 0.5 %, TD 5:1, for details, see "Reference accuracy" section.
- PMC21: up to 0.3 %, TD 5:1, for details, see "Reference accuracy" section.
- PMP21: up to 0.3 %, TD 5:1, for details, see "Reference accuracy" section.

Supply voltage

PMC11:

- 4 to 20 mA output: 10 to 30V DC
- 0 to 10 V output: 12 to 30V DC

PMP11:

- 4 to 20 mA output: 10 to 30V DC
- 0 to 10 V output: 12 to 30V DC

PMC21:

10 to 30 V DC

PMP21: 10 to 30 V DC

Output

PMC11:

- 4 to 20 mA
- 0 to 10 V

PMP11:

- 4 to 20 mA
- 0 to 10 V

PMC21:

4 to 20 mA

PMP21: 4 to 20 mA

Material

PMC11:

- Housing made from 316L (1.4404)
- Process connections made from 316L
- Process isolating diaphragm made from $\rm Al_2O_3$ aluminum oxide ceramic, (Ceraphire®), ultrapure 99.9 %

PMP11:

- Housing made from 316L (1.4404)
- Process connections made from 316L (1.4404)
- Process isolating diaphragm made from 316L (1.4435)

PMC21:

- Housing made from 316L (1.4404)
- Process connections made from 316L
- Process isolating diaphragm made from Al_2O_3 aluminum-oxide ceramic, (Ceraphire®), ultrapure 99.9 %

PMP21:

- Housing made from 316L (1.4404)
- Process connections made from 316L (1.4404)
- Process isolating diaphragm made from 316L (1.4435)

Options


PMC11:

- Certificate of calibration
- Cleaned from oil+grease

PMP11:

- Certificate of calibration
- Cleaned from oil+grease
- PMC21:
- Ex approvals
- Marine certificate
- Min. alarm current setting
- 3.1 Material certificates
- Certificate of calibration
- Cleaned from oil+grease
- Cleaned for O₂ service
- PMP21:
- Ex approvals
- Marine certificate
- Min. alarm current setting
- 3.1 Material certificates
- Certificate of calibration
- Cleaned from oil+grease

Product design

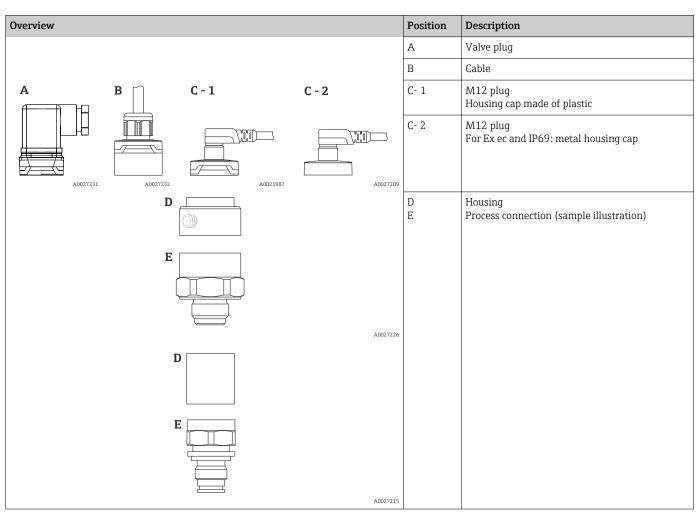

System integration

The device can be given a tag name (max. 32 alphanumeric characters).

Designation	Option ¹⁾
Measuring point (TAG), see additional specifications	Z1

1) Product Configurator order code for "Marking"

Input

Measured variable	Measured process variable
	 PMC11: Gauge pressure PMP11: Gauge pressure PMC21: Gauge pressure or absolute pressure PMP21: Gauge pressure or absolute pressure
	Calculated process variable

Pressure

Measuring range

Ceramic process isolating diaphragm

Sensor	Device	ce Maximum Sensor measuring range		Lowest MWP calibratable	MWP	OPL	Factory settings ²⁾	Option ³⁾
		lower (LRL)	upper (URL)	span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for gauge pres	ssure mea	surement						
100 mbar (1.5 psi) ⁴⁾	PMC21	-0.1 (-1.5)	+0.1 (+1.5)	0.02 (0.3)	2.7 (40.5)	4 (60)	0 to 100 mbar (0 to 1.5 psi)	1C
250 mbar (4 psi) 5)	PMC21	-0.25 (-4)	+0.25 (+4)	0.05 (1)	3.3 (49.5)	5 (75)	0 to 250 mbar (0 to 4 psi)	1E
400 mbar (6 psi) ⁶⁾	PMC11 PMC21	-0.4 (-6)	+0.4 (+6)	0.08 (1.2)	5.3 (79.5)	8 (120)	0 to 400 mbar (0 to 6 psi)	1F
1 bar (15 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+1 (+15)	0.2 (3)	6.7 (100.5)	10 (150)	0 to 1 bar (0 to 15 psi)	1H
2 bar (30 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+2 (+30)	0.4 (6)	12 (180)	18 (270)	0 to 2 bar (0 to 30 psi)	1K
4 bar (60 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+4 (+60)	0.8 (12)	16.7 (250.5)	25 (375)	0 to 4 bar (0 to 60 psi)	1M
6 bar (90 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+6 (+90)	2.4 (36)	26.7 (400.5)	40 (600)	0 to 6 bar (0 to 90 psi)	1N
10 bar (150 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+10 (+150)	2 (30)	26.7 (400.5)	40 (600)	0 to 10 bar (0 to 150 psi)	1P
16 bar (240 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+16 (+240)	6.4 (96)	40 (600)	60 (900)	0 to 16 bar (0 to 240 psi)	1Q
25 bar (375 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+25 (+375)	10 (150)	40 (600)	60 (900)	0 to 25 bar (0 to 375 psi)	1R
40 bar (600 psi) ⁶⁾	PMC11 PMC21	-1 (-15)	+40 (+600)	8 (120)	40 (600)	60 (900)	0 to 40 bar (0 to 600 psi)	15

Sensor	Device	vice Maximum Sensor measuring range		Lowest MWP calibratable	OPL	Factory settings ²⁾	Option ³⁾	
		lower (LRL)	upper (URL)	span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for absolute p	ressure m	leasurement						
100 mbar (1.5 psi) ⁶⁾	PMC21	0	+0.1 (+1.5)	0.1 (1.5)	2.7 (40.5)	4 (60)	0 to 100 mbar (0 to 1.5 psi)	2C
250 mbar (4 psi) ⁶⁾	PMC21	0	+0.25 (+4)	0.25 (4)	3.3 (49.5)	5 (75)	0 to 250 mbar (0 to 4 psi)	2E
400 mbar (6 psi) ⁶⁾	PMC21	0	+0.4 (+6)	0.4 (6)	5.3 (79.5)	8 (120)	0 to 400 mbar (0 to 6 psi)	2F
1 bar (15 psi) ⁶⁾	PMC21	0	+1 (+15)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 1 bar (0 to 15 psi)	2H
2 bar (30 psi) ⁶⁾	PMC21	0	+2 (+30)	0.4 (6)	12 (180)	18 (270)	0 to 2 bar (0 to 30 psi)	2K
4 bar (60 psi) ⁶⁾	PMC21	0	+4 (+60)	0.8 (12)	16.7 (250.5)	25 (375)	0 to 4 bar (0 to 60 psi)	2M
10 bar (150 psi) ⁶⁾	PMC21	0	+10 (+150)	2 (30)	26.7 (400.5)	40 (600)	0 to 10 bar (0 to 150 psi)	2P
40 bar (600 psi) ⁶⁾	PMC21	0	+40 (+600)	8 (120)	40 (600)	60 (900)	0 to 40 bar (0 to 600 psi)	2S

Highest turn down that can be set at the factory: 5:1. The turn down is preset and cannot be changed. 1)

Other measuring ranges (e.g. -1 to +5 bar (-15 to 75 psi)) can be ordered with customer-specific settings (see the Product Configurator, order 2)

code for "Calibration; Unit" option "J"). It is possible to invert the output signal (LRV = 20 mA; URV = 4 mA). Prerequisite: URV < LRV

Product Configurator, order code for "Sensor range" 3)

Vacuum resistance: 0.7 bar (10.5 psi) abs 4)

5) Vacuum resistance: 0.5 bar (7.5 psi) abs Vacuum resistance: 0 bar (0 psi) abs

6)

Maximum turn down which can be ordered for absolute pressure and gauge pressure sensors

Devices for gauge pressure measurement

• 6 bar (90 psi), 16 bar (240 psi), 25 bar (375 psi): TD 1:1 to TD 2.5:1

• All other measuring ranges: TD 1:1 to TD 5:1

Devices for absolute pressure measurement

• 100 mbar (1.5 psi), 250 mbar (4 psi), 400 mbar (6 psi): TD 1:1

- 1 bar (15 psi): TD 1:1 to TD 2.5:1
- All other measuring ranges: TD 1:1 to TD 5:1

Sensor	Device	evice Maximum Sensor measuring range		Lowest calibratable	MWP	OPL	Factory settings ²⁾	Option ³⁾
		lower (LRL)	upper (URL)	span ¹⁾				
		[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]	[bar (psi)]		
Devices for gauge pre	ssure me	asurement						
400 mbar (6 psi) ⁴⁾	PMP11 PMP21	-0.4 (-6)	+0.4 (+6)	0.4 (6)	1 (15)	1.6 (24)	0 to 400 mbar (0 to 6 psi)	1F
1 bar (15 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+1 (+15)	0.4 (6)	2.7 (40.5)	4 (60)	0 to 1 bar (0 to 15 psi)	1H
2 bar (30 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+2 (+30)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 2 bar (0 to 30 psi)	1K
4 bar (60 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+4 (+60)	0.8 (12)	10.7 (160.5)	16 (240)	0 to 4 bar (0 to 60 psi)	1M
6 bar (90 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+6 (+90)	2.4 (36)	16 (240)	24 (360)	0 to 6 bar (0 to 90 psi)	1N
10 bar (150 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+10 (+150)	2 (30)	25 (375)	40 (600)	0 to 10 bar (0 to 150 psi)	1P
16 bar (240 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+16 (+240)	5 (75)	25 (375)	64 (960)	0 to 16 bar (0 to 240 psi)	1Q
25 bar (375 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+25 (+375)	5 (75)	25 (375)	100 (1500)	0 to 25 bar (0 to 375 psi)	1R
40 bar (600 psi) ⁴⁾	PMP11 PMP21	-1 (-15)	+40 (+600)	8 (120)	100 (1500)	160 (2400)	0 to 40 bar (0 to 600 psi)	1S
100 bar (1500 psi) ⁴⁾	PMP21	-1 (-15)	+100 (+1500)	20 (300)	100 (1500)	160 (2400)	0 to 100 bar (0 to 1500 psi)	1U
400 bar (6000 psi) ⁴⁾	PMP21	-1 (-15)	+400 (+6000)	80 (1200)	400 (6000)	600 (9000)	0 to 400 bar (0 to 6 000 psi)	1W
Devices for absolute p	oressure r	neasurement						
400 mbar (6 psi) 4)	PMP21	0 (0)	0.4 (+6)	0.4 (6)	1 (15)	1.6 (24)	0 to 400 mbar (0 to 6 psi)	2F
1 bar (15 psi) ⁴⁾	PMP21	0 (0)	1 (+15)	0.4 (6)	2.7 (40.5)	4 (60)	0 to 1 bar (0 to 15 psi)	2H
2 bar (30 psi) ⁴⁾	PMP21	0 (0)	2 (+30)	0.4 (6)	6.7 (100.5)	10 (150)	0 to 2 bar (0 to 30 psi)	2K
4 bar (60 psi) ⁴⁾	PMP21	0 (0)	4 (+60)	0.8 (12)	10.7 (160.5)	16 (240)	0 to 4 bar (0 to 60 psi)	2M
10 bar (150 psi) ⁴⁾	PMP21	0 (0)	10 (+150)	2 (30)	25 (375)	40 (600)	0 to 10 bar (0 to 150 psi)	2P
40 bar (600 psi) ⁴⁾	PMP21	0 (0)	+40 (+600)	8 (120)	100 (1500)	160 (2400)	0 to 40 bar (0 to 600 psi)	2S
100 bar (1500 psi) ⁴⁾	PMP21	0 (0)	+100 (+1500)	20 (300)	100 (1500)	160 (2400)	0 to 100 bar (0 to 1500 psi)	2U
400 bar (6000 psi) ⁴⁾	PMP21	0 (0)	+400 (+6000)	80 (1200)	400 (6000)	600 (9000)	0 to 400 bar (0 to 6000 psi)	2W

Metal process isolating diaphragm

1) Highest turn down that can be set at the factory: 5:1. The turn down is preset and cannot be changed.

2) Other measuring ranges (e.g. -1 to +5 bar (-15 to 75 psi)) can be ordered with customer-specific settings (see the Product Configurator, order code for "Calibration; Unit" option "J"). It is possible to invert the output signal (LRV = 20 mA; URV = 4 mA). Prerequisite: URV < LRV
 3) Product Configurator, order code for "Sensor range"

4) Vacuum resistance: 0.01 bar (0.145 psi) abs


Maximum turn down which can be	ordered for absolute pressure a	and gauge pressure sensors

Device	Range	400 mbar (6 psi)	1 bar (15 psi) 6 bar (90 psi) 16 bar (240 psi)	2 bar (30 psi) 4 bar (60 psi) 10 bar (150 psi) 25 to 400 bar (375 to 6000 psi)
PMP11	0.5%	TD 1:1	TD 1:1 to TD 2.5:1	TD 1:1 to TD 5:1
PMP21	0.3%	TD 1:1	TD 1:1 to TD 2.5:1	TD 1:1 to TD 5:1

Option 1)

1 2

Output **Output signal** Designation 4 to 20 mA (2-wire) PMC11: 0 to 10 V output (3-wire) PMP11: 0 to 10 V output (3-wire) Product Configurator, order code for "Output" 1) Signal range 4 to 20 mA 3.8 mA to 20.5 mA Load (for 4 to 20 mA In order to guarantee sufficient terminal voltage in two-wire devices, a maximum load resistance R_L (including line resistance) must not be exceeded depending on the supply voltage U_B of the supply unit.

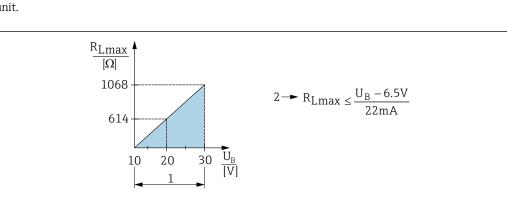

- Power supply 10 to 30 V DC 1
- 2 R_{Lmax} Maximum load resistance

 U_B Supply voltage

Load resistance (for 0 to 10 V The load resistance must be $\geq 5 [k\Omega]$. devices)

Signal on alarm 4 to 20 mA

devices)

The response of the output to error is regulated in accordance with NAMUR NE43. Factory setting MAX alarm: >21 mA


alarm current

Device	Description	Option
PMC21 PMP21	Adjusted min. alarm current	IA ¹⁾

Product Configurator order code for "Service" 1)

Dead time, time constant

Presentation of the dead time and the time constant:

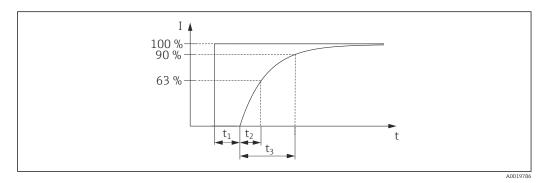

Dynamic behavior	Dead time (t ₁) [ms]	Time constant (T63), t ₂ [ms]	Time constant (T90), t ₃ [ms]	
	6 ms	10 ms	15 ms	


Power supply

WARNING


Limitation of electrical safety due to incorrect connection!

- ► In accordance with IEC/EN61010 a separate circuit breaker must be provided for the device .
- When using the measuring device in hazardous areas, installation must comply with the corresponding national standards and regulations and the Safety Instructions or Installation or Control Drawings.
- All explosion protection data are given in separate documentation which is available upon request. The Ex documentation is supplied as standard with all devices approved for use in explosion hazardous areas.
- Protective circuits against reverse polarity, HF influences and overvoltage peaks are integrated.
- ▶ The device must be operated with a 500 mA fine-wire fuse (slow-blow).

Terminal assignment

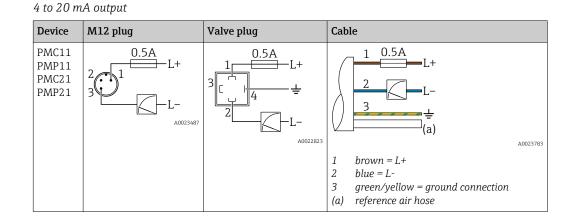

0 to 10 V output

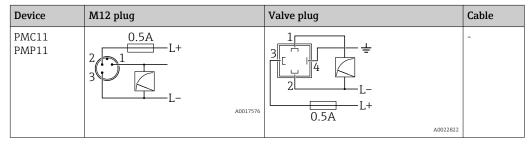

Supply voltage	Electronic version	Device	Supply voltage
	4 to 20 mA output	PMC11 PMP11 PMC21 PMP21	10 to 30 V DC
	0 to 10 V output	PMC11 PMP11	12 to 30 V DC

Current consumption and	Number of wires	Device	Normal operation	Alarm signal ¹⁾
alarm signal	2	PMC11 PMP11 PMC21 PMP21	≤ 26 mA	> 21 mA
	3	PMC11 PMP11	< 12 mA	11 V

1) For MAX alarm (factory setting)

Power supply fault	The de the spe Behavi If the s	ecified characteristics are no lo or in the event of undervoltage	34 V DC without damage. If the supply voltaginger guaranteed. e: ninimum value, the device switches off in a d						
Electrical connection	Degree of protection								
	Device Connection		Degree of protection	Option ¹⁾					
	PMP21 PMP21	Cable5 m (16 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	А					
	PMP21 PMP21	Cable10 m (33 ft)	IP66/68 ²⁾ NEMA type 4X/6P enclosure	В					
	PMP21 Cable25 m (82 ft) PMP21		IP66/68 ²⁾ NEMA type 4X/6P enclosure	С					
	PMC11 M12 plug PMP11		IP65 NEMA type 4X enclosure	L					
	PMC21 PMP21	M12 plug	IP65/67 NEMA type 4X enclosure	М					
	PMC11 Valve plug ISO4400 M16 PMP11 PMC21 PMP21		IP65 NEMA type 4X enclosure	U					
	PMC11 PMP11 PMC21 PMP21	IP65 NEMA type 4X enclosure	V						
	 Product Configurator order code for "Electrical connection" IP 68 (1.83m H2O for 24 h) 								
Cable specification	For valve	plug: < 1.5 mm ² (16 AWG) an	nd Ø4.5 to 10 mm (0.18 to 0.39 in)						
Residual ripple	The device operates within the reference accuracy up to ± 5 % of the residual ripple of the supply voltage, within the permitted voltage range.								
Influence of power supply	≤0.005 %	o of the URL/1 V							
Overvoltage protection	The device does not contain any special elements to protect against overvoltage ("wire to ground"). Nevertheless the requirements of the applicable EMC standard EN 61000-4-5 (testing voltage 1kV EMC wire/ground) are met.								

Performance characteristics of ceramic process isolating diaphragm

Reference operating	 As per IEC 6 	0770					
conditions	 Ambient ten 	nperature T _A = constant = constant, in the range		1 to +33 °C (+70	to +91 °F)		
	 Position of n 	essure $p_A = \text{constant}$, in the neasuring cell = constant position" section $\rightarrow \cong 2$	t, in range: horizon				
	 Zero based s 	pan		., .			
	 Supply volta 	process isolating diaphra ge: 24 V DC ±3 V DC (at 4 to 20 mA output)	-	um-oxide cerami	c, Ceraphire°)		
Measuring uncertainty for small absolute pressure measuring ranges	The smallest extended uncertainty of measurement that can delivered by our standards is: ■ in range 1 to 30 mbar (0.0145 to 0.435 psi): 0.4 % of reading ■ in range < 1 mbar (0.0145 psi): 1 % of reading.						
Influence of the installation position	→ 🗎 23						
Resolution	Current output	Current output: min. 1.6 μA					
Reference accuracy	The reference accuracy contains the non-linearity [DIN EN 61298-2 3.11] including the pressure hysteresis [DIN EN 61298-23.13] and non-repeatability [DIN EN 61298-2 3.11] in accordance with the limit point method as per [DIN EN 60770].						
	Device	% of the calibrated spa	the calibrated span to the maximum turn down				
		Reference accuracy	Non-linear	ity ¹⁾ N	on-repeatability		
	PMC11 ²⁾	±0.5	±0.1	±	0.1		
	PMC21	±0.3	±0.1	±	0.1		
	 The non-linearity for the 40 bar (600 psi) sensor can be up to ± 0.15% of the calibrated span up to the maximum turn down. For devices with 0 to 10 V output, a non-linearity of up to max. 0.3 V can occur for signal values below 0.03 V. Overview of the turn down ranges → 14 						
	Measuring ran	ges	Turn down	Device	% of URL		
	100 mbar (1.5		1:1 to TD 5:1	PMC11	±0.5		
	40 bar (600 psi)		PMC21	±0.3 ¹⁾		
	1) For the 100 mbar (1.5 psi) and 250 mbar (4 psi) measuring ranges, the following applies: In the event of heat effects on the initial reference conditions, an additional deviation of max. 0.3 mbar (4.5 psi) from the zero point or the output span is possible.						
Thermal change of the zero output and the output span	Measuring cell	−20 to +85 °C (−4 t	4 to +185 °F) -40 to -20 °C (-40 to -4 °F) +85 to +100 °C (+185 to +212 °F)				
		% of URL for TD 1	1:1				
	<1 bar (15 psi)	<1		<1.2			
	≥ 1 bar (15 psi)	<0.8		<1			

Long-term stability	1 year	5 years	8 years				
	% of URL						
	±0.2	±0.4	±0.45				

Switch-on time

<2 s (For small measuring ranges, pay attention to the thermal compensation effects.)

	I	5					
Reference operating conditions	 As per IEC 60770 Ambient temperature T_A = constant, in the range of:+21 to +33 °C (+70 to +91 °F) Humidity φ = constant, in the range of 5 to 80 % rH Ambient pressure p_A = constant, in the range of:860 to 1060 mbar (12.47 to 15.37 psi) Position of measuring cell = constant, in range: horizontal ±1° (see also "Influence of the installation position" section → 23) Zero based span Process isolating diaphragm material: AISI 316L (1.4435) Filling oil: synthetic oil polyalphaolefin FDA 21 CFR 178.3620, NSF H1 Supply voltage: 24 V DC ±3 V DC Load: 320 Ω (at 4 to 20 mA output) 						
Measuring uncertainty for small absolute pressure measuring ranges	 in the range 	e 1 to 3	ed uncertainty of m 0 mbar (0.0145 to 0. bar (0.0145 psi): 1 %	435 psi): 0.4 %		rered by our standards is:	
Influence of the installation position	→ 🗎 23						
Resolution	Current output	t: min.	1.6 μΑ				
Reference accuracy	The reference accuracy contains the non-linearity [DIN EN 61298-2 3.11] including the pressure hysteresis [DIN EN 61298-23.13] and non-repeatability [DIN EN 61298-2 3.11] in accordance with the limit point method as per [DIN EN 60770].						
	Device	% of	the calibrated span to	he calibrated span to the maximum turn down			
		Refe	rence accuracy	Non-line	earity	Non-repeatability	
	PMP11 ¹⁾	±0.5		±0.1		±0.1	
	PMP21	±0.3		±0.1		±0.1	
Thermal change of the zero output and the output span	0.015 V.	ie turn	0 to 10 V output, a non- down ranges → 🗎 1 -20 to +85 °C (-4 to +2	5	-20 to -40	an occur for signal values below °C (–4 to –40 °F) 10 °C (+185 to +212 °F)	
			% of the calibrated spa	an for TD 1:1			
	<1 bar (15 psi)		<1		<1.2		
	≥ 1 bar (15 psi))	<0.8		<1		
ong-term stability	Device		1 year	5 years		8 years	
				I	% of URL		
	PMP11 PMP21		±0.2	±0.4		±0.45	

Performance characteristics of metal process isolating diaphragm

Installation

Installation conditions	connection an Point the cab	nd during operation.	ing when mounting the device, Irds where possible to prevent r		
Influence of the installation position	Any orientation is possible. However, the orientation may cause a zero point shift i.e. the measured value does not show zero when the vessel is empty or partially full.				
		A	B C	A0024700	
	Туре	Process isolating diaphragm axis is horizontal (A)	Process isolating diaphragm pointing upwards (B)	Process isolating diaphragm pointing downwards (C)	
	PMP11 PMP21	Calibration position, no effect	Up to +4 mbar (+0.058 psi)	Up to -4 mbar (-0.058 psi)	
	PMC11, PMC21	Calibration position, no	Up to	Up to	

Mounting location

Pressure measurement

< 1 bar (15 psi)

PMC11, PMC21

≥1 bar (15 psi)

Pressure measurement in gases

effect

effect

Calibration position, no


Mount the device with shutoff device above the tapping point so that any condensate can flow into the process.

+0.3 mbar (+0.0044 psi)

Up to +3 mbar (+0.0435 psi)

-0.3 mbar (-0.0044 psi)

Up to -3 mbar (-0.0435 psi)

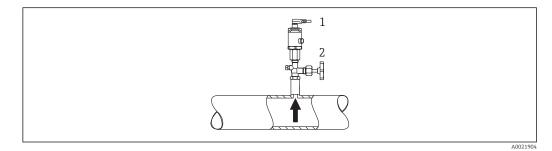

1 Device


2 Shutoff device

Pressure measurement in vapors

For pressure measurement in vapors, use a siphon. The siphon reduces the temperature to almost ambient temperature. Mount the device with a shutoff device at the same height as the tapping point.

Advantage: only minor/negligible heat effects on the device.


Note the max. permitted ambient temperature of the transmitter!

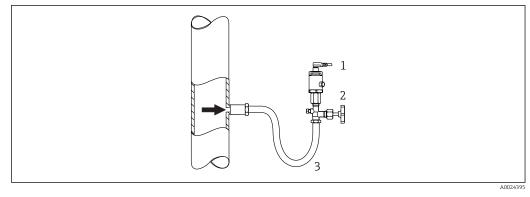

- 1 Device
- 2 Shutoff device
- 3 Siphon

Pressure measurement in liquids

Mount the device with a shutoff device at the same height as the tapping point.

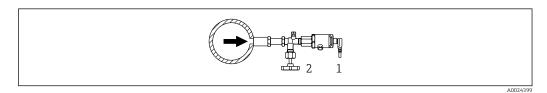


1 Device

2 Shutoff device

Level measurement

- Always install the device below the lowest measuring point.
- Do not install the device at the following positions:
 - In the filling curtain
 - In the tank outlet
 - in the suction area of a pump
 - Or at a point in the tank which could be affected by pressure pulses from the agitator.

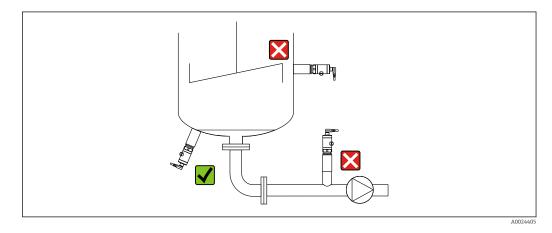

Mounting instructions for oxygen applications

Oxygen and other gases can react explosively to oils, grease and plastics, such that, among other things, the following precautions must be taken:

- All components of the system, such as measuring devices, must be cleaned in accordance with the BAM requirements.
- Dependent on the materials used, a certain maximum temperature and a maximum pressure for oxygen applications must not be exceeded.
- The following table lists devices (devices only, not accessories or enclosed accessories), which are suitable for gaseous oxygen applications.

Device	p _{max} for oxygen applications	T _{max} for oxygen applications	Option ¹⁾
PMC21	40 bar (600 psi)	–10 to +60 °C (+14 to +140 °F)	HB

1) Product Configurator, order code for "Service"

Ambient temperature range	Device Ambient temperature range ¹⁾						
	PMC11 PMP11	-40 to +70 °C	(-40 to +158	3 °F)			
	PMC21 PMP21	−40 to +85 °C	(-40 to +185	5 °F)			
	PMC21 Devices for hazardous areas: -40 to +70 °C (-40 to +158 °F) PMP21						
				igned for an ambient temperature range of luct Configurator order code for "Enclosed accesso	ries" option "RZ".		
Storage temperature range	-40 to +8	85 °C (-40 to +18	5 °F)				
Climate class	Device	Climate class	Note				
	PMC11 PMP11 PMC21 PMP21	relative humidity: 4 to 95 % satisfied according to IEC 721-3-3 (condensation not possible					
Degree of protection	Device	Connection		Degree of protection	Option ¹⁾		
	PMP21 PMP21	Cable5 m (16 ft)		IP66/68 ²⁾ NEMA type 4X/6P enclosure	A		
	PMP21 PMP21	Cable10 m (33 ft))	IP66/68 ²⁾ NEMA type 4X/6P enclosure	В		
	PMP21 PMP21	Cable25 m (82 ft))	IP66/68 ²⁾ NEMA type 4X/6P enclosure	С		
	PMC11 PMP11	M12 plug		IP65 NEMA type 4X enclosure	L		
	PMC21 PMP21	M12 plug		IP65/67 NEMA type 4X enclosure	М		
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO44	00 M16	IP65 NEMA type 4X enclosure	U		
	PMC11 PMP11 PMC21 PMP21	Valve plug ISO44	00 NPT ½	IP65 NEMA type 4X enclosure	V		
		luct Configurator oi 8 (1.83m H2O for 2		"Electrical connection"			
Vibration resistance	Test stan	dard		Vibration resistance			
	IEC 60068	3-2-64:2008		Guaranteed for 5 to 2000Hz: 0.05g ² /Hz			
Electromagnetic compatibility	InterferNAMUI		s per EN 61 on EMC (NE				

Environment

For more details please refer to the Declaration of Conformity.

Process

Process temperature range for devices with ceramic process isolating diaphragm

Device	Process temperature range
PMC11	−25 to +85 °C (−13 to +185 °F)
PMC21	–25 to +100 °C (–13 to +212 °F)
PMC21 for oxygen applications	-10 to +60 °C (+14 to +140 °F)

- For saturated steam applications, use a device with a metal process isolating diaphragm, or provide a siphon for temperature isolation when installing.
- Pay attention to the process temperature range of the seal. See also the following table.

Seal	Notes	Process temperature range	Option
FKM	-	-20 to +100 °C (-4 to +212 °F)	A 1)
FKM	Cleaned for oxygen service	-10 to +60 °C (+14 to +140 °F)	A $^{1)}$ and HB $^{2)}$
EPDM 70	-	-25 to +100 °C (-13 to +212 °F)	J ¹⁾

1) Product Configurator, order code for "Seal"

2) Product Configurator, order code for "Service"

Applications with changes in temperature

Frequent extreme changes in temperatures can temporarily cause measuring errors. Temperature compensation takes place after a few minutes. Internal temperature compensation is faster the smaller the change in temperature and the longer the time interval.

For further information please contact your local Endress+Hauser Sales Center.

Process temperature range for devices with metallic	Device	Process temperature range
process isolating diaphragm	PMP11	-25 to +85 °C (-13 to +185 °F)
	PMP21	-40 to +100 °C (-40 to +212 °F)

Applications with changes in temperature

Frequent extreme changes in temperatures can temporarily cause measuring errors. Internal temperature compensation is faster the smaller the change in temperature and the longer the time interval.

For further information please contact your local Endress+Hauser Sales Center.

Pressure specifications

WARNING

The maximum pressure for the measuring device depends on the lowest-rated element with regard to pressure.

- For pressure specifications, see the "Measuring range" section and the "Mechanical construction" section.
- The Pressure Equipment Directive (2014/68/EU) uses the abbreviation "PS". The abbreviation "PS" corresponds to the MWP (maximum working pressure) of the measuring device.
- MWP (maximum working pressure): The MWP (maximum working pressure) is specified on the nameplate. This value is based on a reference temperature of +20 °C (+68 °F) and may be applied to the device for an unlimited period of time. Observe the temperature dependency of the MWP.
- OPL (over pressure limit): The test pressure corresponds to the over pressure limit of the sensor and may only be applied temporarily to ensure that the measurement is within the specifications and no permanent damage develops. In the case of sensor range and process connections where the over pressure limit (OPL) of the process connection is smaller than the nominal value of the sensor, the device is set at the factory, at the very maximum, to the OPL value of the process connection. If you want to use the entire sensor range, select a process connection with a higher OPL value.
- Oxygen applications: In oxygen applications, the values for "p_{max} and T_{max} for oxygen applications may not be exceeded.
- Devices with ceramic process isolating diaphragm: avoid steam hammering! Steam hammering can cause zero point drifts. Recommendation: Residue (water droplets or condensation) may remain on the process isolating diaphragm following CIP cleaning and can result in local steam hammering the next time steam cleaning takes place. In practice, drying the process isolating diaphragm (e.g. by blowing) has proved to prevent steam hammering.

Mechanical construction


• The following dimensions have been rounded up to whole measurements.

 Exact dimensions are available in the Product Configurator on the Endress+Hauser website: www.endress.com → Product finder → On the product page, click the "Configure" button to the right of the product photo.


Design, dimensions	Device height
	The device height is calculated from
	the height of the electrical connection
	the height of the housing and

the height of the individual process connection.

The individual heights of the components are listed in the following sections. To calculate the device height simply add up the individual heights of the components. Where applicable also take into consideration the installation distance (space that is used to install the device). You can use the following table for this purpose:

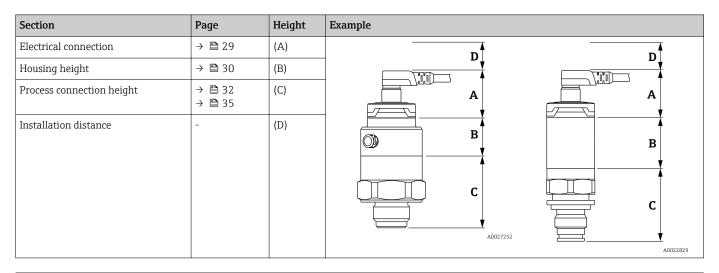

Electrical connection

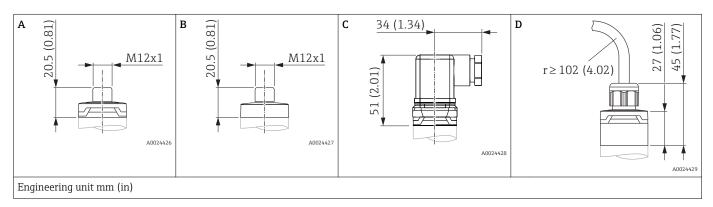



Position	Designation	Material	Weight kg (lbs)	Device	Option ¹⁾
A	M12 plug IP65 (Additional dimensions $\rightarrow \square 47$)	Housing cap made of plastic	0.012 (0.03)	PMC11 PMP11	L
A	M12 plug IP65/67 (Additional dimensions → 🗎 47)	Housing cap made of plastic	0.012 (0.03)	PMC21 PMP21	M Plug connector with cable can be ordered as an accessory → 🗎 47
В	M12 plug IP66/67	Housing cap made of metal	0.030 (0.07)		In the case of Ex ec type of protection, the housing cap is made of metal.

Position	Designation	Material	Weight kg (lbs)	Device	Option ¹⁾
С	M16 valve plug	Plastic PPSU	0.060 (0.14)	PMC11 PMP11 PMC21 PMP21	U
С	NPT ½ valve plug	Plastic PPSU	0.060 (0.14)	PMC11 PMP11 PMC21 PMP21	V
D	Cable5 m (16 ft)	PUR (UL94V0)	0.280 (0.62)	PMC21 PMP21	A
D	Cable10 m (33 ft)	PUR (UL94V0)	0.570 (1.26)	PMC21 PMP21	В
D	Cable25 m (82 ft)	PUR (UL94V0)	1.400 (3.09)	PMC21 PMP21	C

1) Product Configurator, order code for "Electrical connection"


Housing

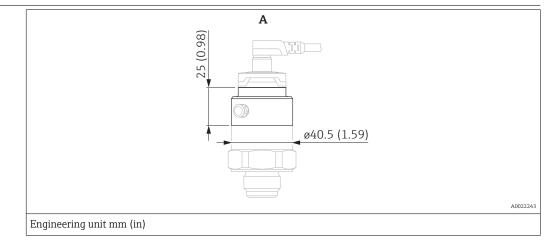

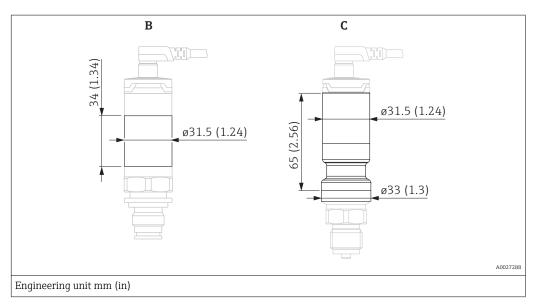


Position	Device	Material	Weight kg (lbs)
A	PMC11 PMC21	Stainless steel 316L	0.150 (0.33)
B (up to 100 bar (1500 psi))	PMP11 PMP21	Stainless steel 316L	0.090 (0.20)
C (400 bar (6 000 psi))	PMP11 PMP21	Stainless steel 316L	0.090 (0.20)


Process connections with internal, ceramic process isolating diaphragm

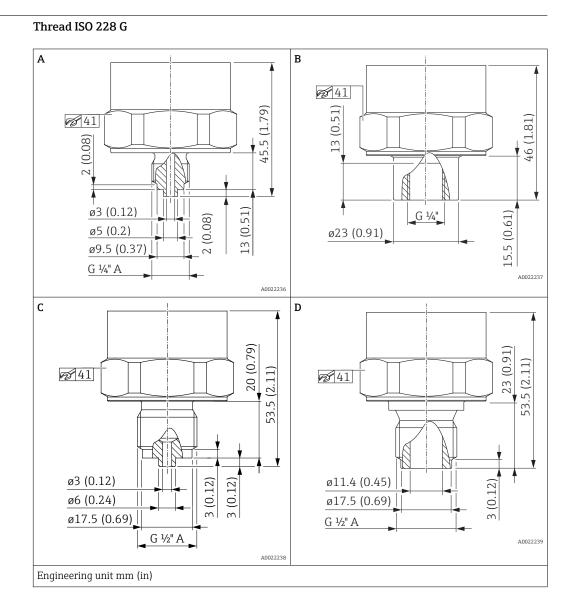

Device	Position	Designation Mat		Weight	Option ¹⁾
				kg (lbs)	
PMC11PMC21	A	Thread ISO 228 G ¼" A, EN 837	316L	0.160 (0.35)	WTJ
PMC11PMC21	В	Thread ISO 228 G ¼" (female)	316L	0.180 (0.40)	WAJ
PMC11PMC21	С	Thread ISO 228 G ½" A, EN 837	316L	0.180 (0.40)	WBJ
PMC11PMC21	D	Thread ISO 228 G ½" A, bore11.4 mm (0.45 in)	316L	0.180 (0.40)	WWJ

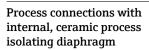


Thread ASME

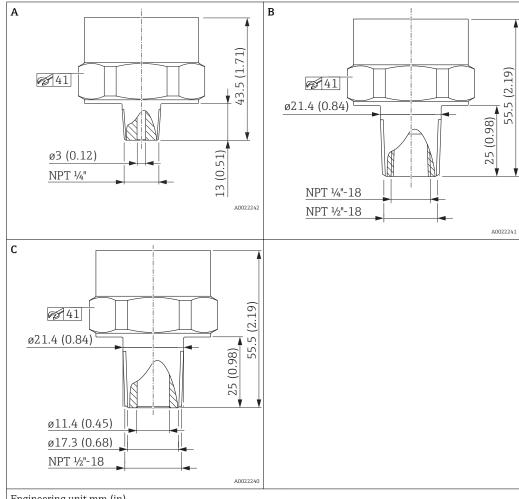


Engineering unit mm (in)
-----------------------	-----

Device	Position	Designation	Material	Weight	Approval	Option ¹⁾
				kg (lbs)		
PMC11PMC21	А	ASME ¼" MNPT, bore3 mm (0.12 in)	316L	0.160 (0.35)	CRN	VUJ
PMC11PMC21	В	ASME ½" MNPT, ¼" FNPT (female)	316L	0.190 (0.42)	CRN	VXJ
PMC11PMC21	С	ASME ½" MNPT, bore11.4 mm (0.45 in)	316L	0.190 (0.42)	CRN	VWJ

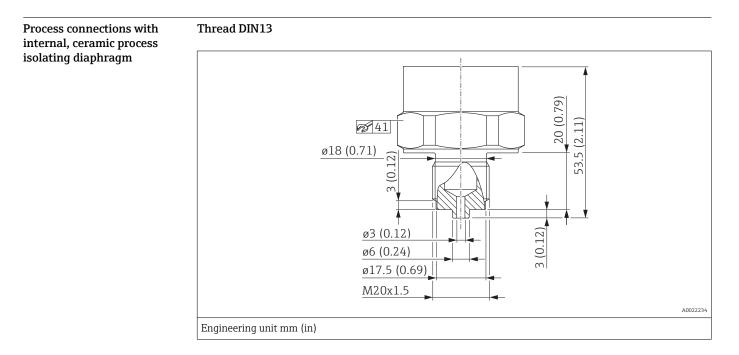


Device	Designation N		Weight	Option ¹⁾
			kg (lbs)	
PMC11PMC21	DIN 13 M20 x 1.5, EN 837, bore 3 mm (0.12 in)	316L	0.180 (0.40)	X4J


Process connections with internal, ceramic process isolating diaphragm

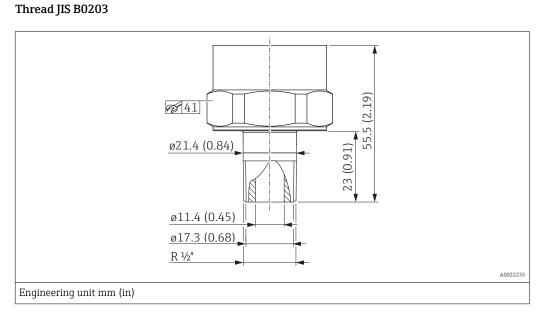


Device	Designation	Material	Weight	Option ¹⁾
			kg (lbs)	
PMC21	JIS B0203 R 1/2 (male)	316L	0.180 (0.40)	ZJJ

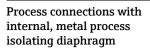

Thread ISO 228 G

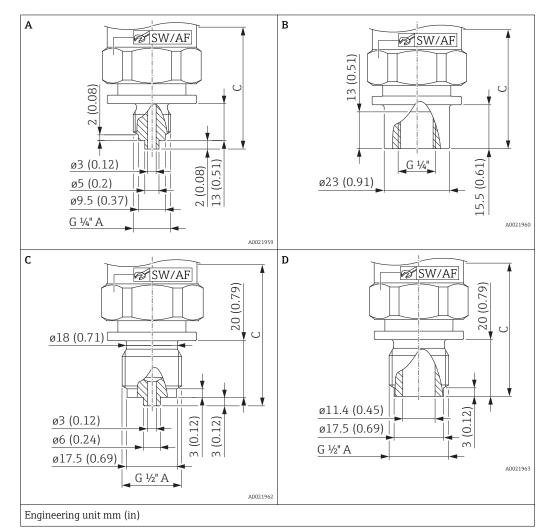


Position	Device	Description	Material	Nominal valu to 100 bar (1			Nominal valu 400 bar (600	Option ¹⁾		
				Weight	Height C	t C SW/ AF	Weight	Height C	SW/	
				kg (lbs)			kg (lbs)		AF	
A	PMP11 PMP21	Thread ISO 228 G ¼" A, EN 837	316L	0.200 (0.44)	57 (2.24)	32	0.240 (0.53)	69 (2.72)	27	WTJ
В	PMP11 PMP21	Thread ISO 228 G ¼" (female)	316L	0.220 (0.49)	57 (2.24)	32	0.260 (0.57)	69 (2.72)	27	WAJ
С	PMP11 PMP21	Thread ISO 228 G ½" A, EN 837	316L	0.220 (0.49)	65 (2.56)	32	0.270 (0.60)	77 (3.03)	27	WBJ
D	PMP11 PMP21	Thread ISO 228 G ½" A, bore11.4 mm (0.45 in)	316L	0.220 (0.49)	62 (2.44)	32	0.260 (0.57)	74 (2.91)	27	WWJ

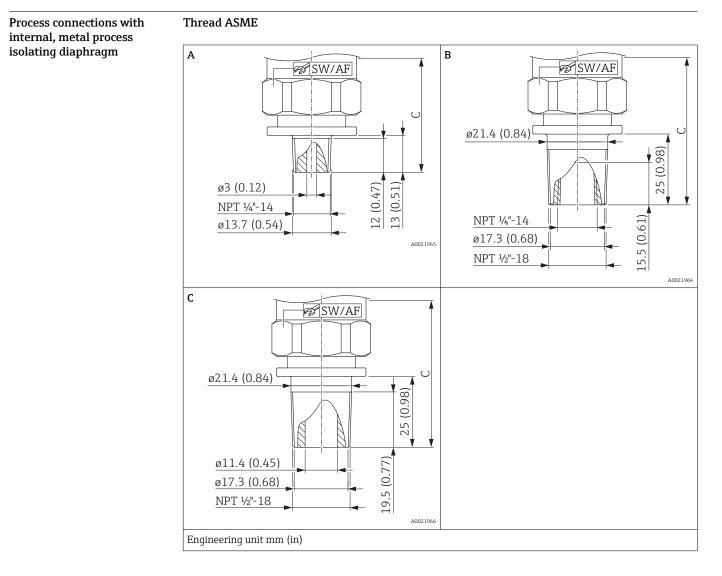

Position	Device	Designation	Material	Nominal value to 100 bar (1500 psi)			Nominal value 400 bar (6000 psi)			Approval	Option ¹⁾	
				Weight	Height C	AF	-	5	Height C	SW/		
				kg (lbs)			kg (lbs)		AF			
A	PMP11 PMP21	ASME ¼" MNPT, bore3 mm (0.12 in)	316L	0.200 (0.44)	55 (2.17)	32	0.240 (0.53)	67 (2.64)	27	CRN	VUJ	
В	PMP11 PMP21	ASME ½" MNPT, ¼" FNPT (female)	316L	0.230 (0.51)	67 (2.64)	32	0.260 (0.57)	79 (3.11)	27	CRN	VXJ	
С	PMP11 PMP21	ASME ½" MNPT, bore11.4 mm (0.45 in)	316L	0.230 (0.51)	67 (2.67)	32	0.270 (0.60)	79 (3.11)	27	CRN	VWJ	

Process connections with internal, metal process isolating diaphragm


Thread DIN13

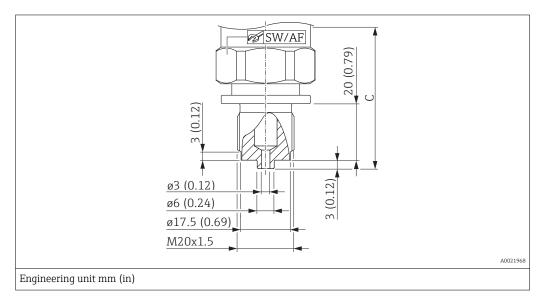

Description	Device		Nominal valu to 100 bar (1			Nominal valu 400 bar (600			Option ¹⁾
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)		AF	kg (lbs)		AF	
DIN 13 M20 x 1.5, EN 837, bore 3 mm (0.12 in)	PMP11 PMP21	316L	0.220 (0.49)	65 (2.56)	32	0.260 (0.57)	77 (3.03)	27	X4J

1) Product Configurator, order code for "Process connection"

Process connections with internal, metal process isolating diaphragm

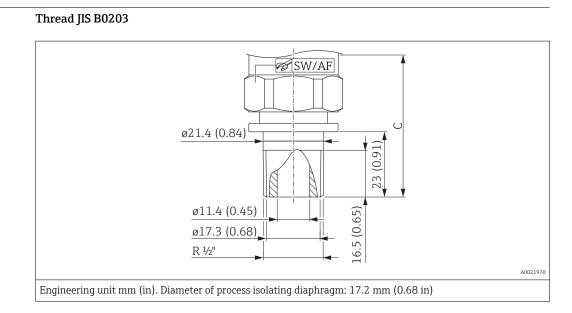


Description	Device	Material	Nominal value to 100 bar (1500) psi)		Nominal value 400 bar (6000 p	si)		Option ¹⁾
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)		AF	kg (lbs)		AF	
JIS B0203 R ½" (male)	PMP21	316L	0.230 (0.51)	65 (2.56)	32	0.260 (0.57)	77 (3.03)	27	ZJJ

1) Product Configurator, order code for "Process connection"


Process connections with flush-mounted, metal process isolating diaphragm

Thread ISO 228 G

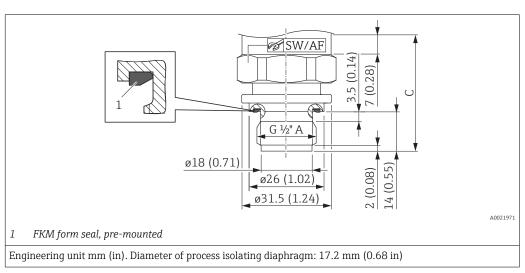

Device	Designation	Material	Nominal value to 100 bar (1500) psi)		Nominal value 400 bar (6 000 p	si)		Option ¹⁾
			Weight	Height C	SW/	Weight	Height C	SW/	
			kg (lbs)		AF	kg (lbs)		AF	
PMP11 PMP21	Thread ISO 228 G ½" A DIN3852, shape E	316L	0.140 (0.31)	41 (1.61)	32	0.120 (0.26)	35 (1.38)	32	WJJ

1) Product Configurator, order code for "Process connection"

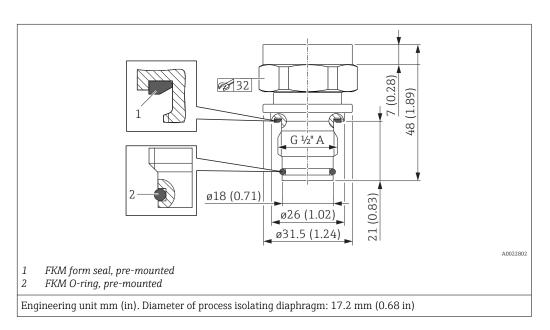

Device ¹⁾	Designation		Weight kg (lbs)	Option ²⁾
PMP11 PMP21	Thread ISO 228 G ½" A O-ring seal, flush-mounted	316L	0.150 (0.33)	WUJ

1) Suitable for weld-in adapter 52002643 and 52010172

2) Product Configurator, order code for "Process connection"

Materials in contact with	NOTICE
process	• Device components in contact with the process are listed in the "Mechanical construction" and
	"Ordering information" sections.

TSE Certificate of Suitability

The following applies to all device components in contact with the process:

- They do not contain any materials derived from animals.
- No additives or operating materials derived from animals are used in production or processing.

Process connections

Endress+Hauser supplies a threaded connection made of stainless steel in accordance with AISI 316L (DIN/ EN material number 1.4404 or 1.4435). With regard to their stability-temperature property, the materials 1.4404 and 1.4435 are grouped together under 13E0 in EN 1092-1: 2001 Tab. 18. The chemical composition of the two materials can be identical.


Process isolating diaphragm

Description	Material
Ceramic process isolating diaphragm	Al_2O_3 aluminum-oxide ceramic, Ceraphire [®] FDA, ultrapure 99.9 % (see also www.endress.com/ceraphire) The US Food & Drug Administration (FDA) has no objections to the use of ceramics made from aluminum oxide as a surface material in contact with foodstuffs. This declaration is based on the FDA certificates of our ceramic suppliers.
Metal process isolating diaphragm	AISI 316L (DIN/EN material number 1.4435)

Seals

See the specific process connection.

Materials not in contact with Housing process

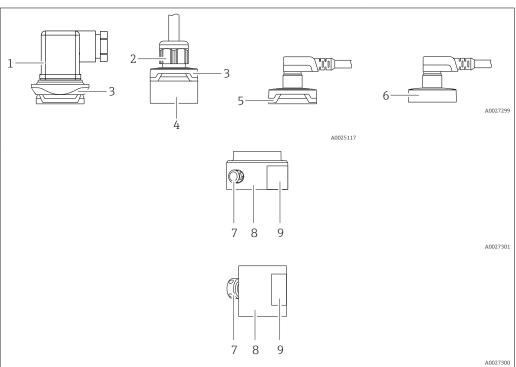

Item number	Component part	Material
1	Valve plug	Seal: NBRPlug: PAScrew: V2A
2	Cable	Pressure screw: PVDFSeal: TPE-VCable: PUR (UL 94 V0)
3	Design element	PBT/PC
4	Connection	PPSU
5	M12 plug	Plastic: PPSU
6	M12 plug	316L (1.4404) For Ex ec: metal housing cap
7	Pressure compensation element	PMP11: PBT/PC PMP21 standard: PBT/PC PMP21 with Ex ec approval: 316L (1.4404)
8	Housing	316L (1.4404)
9	Nameplates	Plastic foil (attached to housing) or directly lasered onto the housing

Filling oil

Device	Filling oil
PMP11 PMP21	Synthetic oil polyalphaolefin FDA 21 CFR 178.3620, NSF H1

Cleaning

Device	Description	Option ¹⁾
PMC11	Cleaned from oil+grease	НА
PMP11	5	
PMC21		
PMP21		
PMC21	Cleaned for oxygen service	НВ

1) Product Configurator, order code for "Service"

Operability

Plug-on display PHX20 (optional) Devices with valve plug can be fitted with the optional local display PHX20.

Designation	Option ¹⁾
Plug-on display PHX20, IP65	RU

1) Product Configurator, order code for "Accessories"

A 1-line liquid crystal display (LCD) is used. The local display shows measured values, fault messages and information messages. The device display can be turned in 90° steps. Depending on the orientation of the device, it is therefore easy to read the measured values.


Technical data

Display:	4-digit, red LED display
Digit height:	7.62 mm; programmable decimal point setting
Display range:	-19999999
Accuracy:	0.2% of span ±1 digit
Electrical connection:	to transmitter with 4 to 20 mA output and elbow plug DIN 43 650, with reverse polarity protection
Power supply for display:	not required, self-powered by the current loop
Voltage drop:	\leq 5 V (corresponds to load: max. 250 Ω)
Conversion rate:	3 measurements per second
Damping:	0.3 to 20 s (configurable)
Data backup:	non-volatile EEPROM
Error message:	HI: OverrangingLO: Underranging
Programming:	via 2 buttons, menu-guided, scaling of display range, decimal point, damping, error message
Degree of protection:	IP 65
Effect of temperature on display:	0.1% / 10 K
Electromagnetic compatibility (EMC):	Interference emission as per EN 50081, interference immunity as per EN 50082
Permitted current load:	max. 60 mA
Ambient temperature:	0 to +60 °C (+32 to +140 °F)
Housing material:	Plastic Pa6 GF30, blue Front screen made of PMMA, red
Order number:	52022914

Certificates and approvals

CE mark		e meets the legal requirements of the relevents been successfully tested by applying the successfully tested by applying		lauser confirms tha
RoHS		uring system complies with the substance s Directive 2011/65/EU (RoHS 2).	restrictions of the Restriction	ı on Hazardous
RCM-Tick marking	Authority) as health a	ed product or measuring system meets th requirements for network integrity, integ and safety regulations. Here, especially th ity are met. The products are labelled wit	roperability, performance cha e regulatory arrangements fo	racteristics as well r electromagnetic
			<u>ک</u>	A002
EAC conformity		1, PMP21 and PMP23 devices meet the l These are listed in the corresponding EA applied.		
	Endress+F	lauser confirms successful testing of the c	levice by affixing to it the EA	C mark.
Approval	CSA C/US	General Purpose		
Approval Safety Instructions (XA)	Depending	General Purpose J on the approval, the following Safety Ins egral part of the Operating Instructions.	structions (XA) are supplied w	rith the device. The
	Depending	g on the approval, the following Safety Ins	structions (XA) are supplied w Documentation	rith the device. The Option ¹⁾
	Depending are an inte	g on the approval, the following Safety Insegral part of the Operating Instructions.		
	Depending are an inte Device	g on the approval, the following Safety Insegral part of the Operating Instructions.	Documentation	Option ¹⁾
	Depending are an inte Device PMP21	g on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb	Documentation XA01271P	Option ¹⁾ BA
	Depending are an inte Device PMP21 PMC21 PMC21	on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb	Documentation XA01271P XA01271P	Option ¹⁾ BA BB
	Depending are an inte Device PMP21 PMC21 PMC21 PMP21 PMC21	y on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb ATEX II 3G Ex ec IIC T4 Gc	Documentation XA01271P XA01271P XA01533P	Option ¹⁾ BA BB BC
	Depending are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMP21 PMC21 PMC21	g on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb ATEX II 3G Ex ec IIC T4 Gc FM IS Cl. I, Div.1 Gr. A-D T4	DocumentationXA01271PXA01271PXA01533PXA01321P	Option 1)BABBBCFA
	Depending are an inte PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21	g on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb ATEX II 3G Ex ec IIC T4 Gc FM IS Cl. I, Div.1 Gr. A-D T4 CSA C/US IS Cl. I Div. 1 Gr. A-D	DocumentationXA01271PXA01271PXA01533PXA01321PXA01322P	Option 1)BABBBCFACB
	Depending are an interview PMP21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21 PMC21	g on the approval, the following Safety Insegral part of the Operating Instructions. Directive ATEX II 1/2G Ex ia IIC T4 Ga/Gb ATEX II 2G Ex ia IIC T4 Gb ATEX II 3G Ex ec IIC T4 Gc FM IS Cl. I, Div.1 Gr. A-D T4 CSA C/US IS Cl. I Div. 1 Gr. A-D EAC Ex ia IIC T4 Ga/Gb	DocumentationXA01271PXA01271PXA01533PXA01321PXA01322PXA01540P	Option 1)BABBBCFACBGA

1) Product Configurator order code for "Approval"

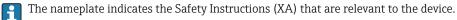

Marine approval (pending)	Device	Designation	Option ¹⁾	
	PMC21 PMP21	DNV GL	LE	
	PMC21 PMP21	ABS	LF	
	PMC21 PMP21	RINA	LV	
	1) Product Configurator, o	order code for "Additional approval"		
Pressure Equipment	Pressure equipment with allowable pressure ≤ 200 bar (2 900 psi)			
Directive 2014/68/EU (PED)	Pressure equipment (with a maximum allowable pressure PS \leq 200 bar (2 900 psi)) can be classified as pressure accessories in accordance with Pressure Equipment Directive 2014/68/EU. If the maximum allowable pressure is \leq 200 bar (2 900 psi) and the pressurized volume of the pressure equipment is \leq 0.1 l, the pressure equipment is subject to the Pressure Equipment Directive (cf. Pressure Equipment Directive 2014/68/EU, Article 4, point 3). The Pressure Equipment Directive only requires that the pressure equipment shall be designed and manufactured in accordance with the "sound engineering practice of a Member State". <i>Reasons:</i>			
	 Pressure Equipment Directive (PED) 2014/68/EU Article 4, point 3 Pressure equipment directive 2014/68/EU, Commission's Working Group "Pressure", Guideline A-05 + A-06 			
	Note:			
	A partial examination shall be performed for pressure instruments that are part of safety equipment for the protection of a pipe or vessel from exceeding allowable limits (safety accessory in accordance with Pressure Equipment Directive 2014/68/EU, Article 2, point 4).			
	Pressure equipment with allowable pressure > 200 bar (2900 psi)			
	<0.1 l and a max. allowabl requirements set out in Ar Article 13 pressure equipm conformity assessment of	nated for application in every process fluid the pressure PS > 200 bar (2900 psi) shall s nnex I of the Pressure Equipment Directive nent shall be classified by category in accor the pressure equipment shall be determine e-mentioned low pressurized volume. Thes	atisfy the essential safety 2014/68/EU. According to rdance with Annex II. The ed by the category I under	
	Reasons:			
		ective 2014/68/EU, Article 13, Annex II ective 2014/68/EU, Commission's Working	g Group "Pressure", Guideline	
	Note:			
	A partial examination shall be performed for pressure instruments that are part of safety equipment for the protection of a pipe or vessel from exceeding allowable limits (safety accessory in accordance with Pressure Equipment Directive 2014/68/EU, Article 2, point 4).			
	The following also applies:			
	PMP21 with threaded connection and internal process isolating diaphragm PN > 200 :			
	Suitable for stable gases in group 1, category I, module A			
Other standards and guidelines	The applicable European guidelines and standards can be found in the relevant EU Declarations of Conformity. The following standards were also applied:			
	DIN EN 60770 (IEC 6077	0):		
		ustrial process control systems Part 1: Me	thods for performance	

Methods for evaluating the performance of transmitters for control and regulation in industrial process control systems.

DIN 16086:

Electrical pressure measuring instruments, pressure sensors, pressure transmitters, pressure measuring instruments, concepts, specifications on data sheets

Procedure for writing specifications in data sheets for electrical pressure measuring instruments, pressure sensors and pressure transmitters.

EN 61326-X:

EMC product family standard for electrical equipment for measurement, control and laboratory use.

EN 60529:

Degrees of protection provided by enclosures (IP code)

NAMUR - User association of automation technology in process industries.

NE21 - Electromagnetic Compatibility (EMC) of Industrial Process and Laboratory Control Equipment.

NE43 - Standardization of the Signal Level for the Failure Information of Digital Transmitters.

NE44 - Standardization of Status Indicators on PCT Instruments with the Help of Light Emitting Diodes

NE53 - Software of Field Devices and Signal-processing Devices with Digital Electronics

CRN approvalA CRN approval is available for some device versions. A CRN-approved process connection with a
CSA approval must be ordered for a CRN-approved device. The CRN-approved devices are assigned
the registration number 0F18141.5C.

Ordering information: Product Configurator, order code for "Process connection" (the CRN process connections are indicated appropriately in the "Mechanical construction" section.)

Calibration unit	Designation	Option ¹⁾
	Sensor range; %	А
	Sensor range; mbar/bar	В
	Sensor range; kPa/MPa	С
	Sensor range; psi	F
	Customer-specific; see additional spec.	J

1) Product Configurator, order code for "Calibration; unit"

Calibration	Designation	Option ¹⁾	
	3-point certificate of calibration	F3	

1) Product Configurator order code for "Calibration"

Inspection certificates	Device	Designation	Option ¹⁾
	PMC21 PMP21	3.1 Material documentation, wetted metal parts, EN10204-3.1 inspection certificate	JA

1) Product Configurator, order code for "Test, Certificate"

Ordering information

Detailed ordering information is available from the following sources:

- In the Product Configurator on the Endress+Hauser website: www.endress.com -> Click "Corporate"
 -> Select your country -> Click "Products" -> Select the product using the filters and search field ->
 Open product page -> The "Configure" button to the right of the product image opens the Product
 Configurator.
- From your Endress+Hauser Sales Center: www.addresses.endress.com
- Product Configurator the tool for individual product configuration
- Up-to-the-minute configuration data
 - Depending on the device: Direct input of measuring point-specific information such as measuring range or operating language
 - Automatic verification of exclusion criteria
 - Automatic creation of the order code and its breakdown in PDF or Excel output format
 - Ability to order directly in the Endress+Hauser Online Shop

Scope of delivery

- Measuring device
- Optional accessories
- Brief Operating Instructions
- Certificates

Accessories

Weld-in adapter

Various weld-in adapters are available for installation in vessels or pipes.

Device	Description	Option ¹⁾	Order number
PMP21	Weld-in adapter G½, 316L	QA	52002643
PMP21	Weld-in adapter G½, 316L 3.1 EN10204-3.1 material, inspection certificate	QB	52010172
PMP21	Weld-in tool adapter G½, brass	QC	52005082
PMP21	Weld-in adapter G1/2, 316L, for G1/2 A DIN 3852	QM	71389241
PMP21	Weld-in adapter G1/2, 316L, 3.1, for G1/2 A DIN 3852, EN10204-3.1 material, inspection certificate	QN	71389243

1) Product Configurator, order code for "Enclosed accessories"

→ 🗎 42

If installed horizontally and weld-in adapters with a leakage hole are used, ensure that the leakage hole is pointing down. This allows leaks to be detected as quickly as possible.

Plug-on display PHX20

M12 plug connectors	Connector	Degree of protection	Material	Option ¹⁾	Order number
	M12 (self-terminated connection at M12 plug)	IP67	 Union nut: Cu Sn/Ni Body: PBT Seal: NBR 	R1	52006263
	53 (2.09) A0024475 M12 90 degrees	IP67	 Union nut: GD Zn/Ni 	RZ	52010285
	with 5m (16 ft) cable		 Body: PUR Cable: PVC Cable colors 		
	≥40 (1.57) A0024476		 1 = BN = brown 2 = WT = white 3 = BU = blue 4 = BK = black 		
	M12 90 degrees (self-terminated connection at M12 plug)	IP67	 Union nut: GD Zn/Ni Body: PBT Seal: NBR 	RM	71114212

1) Product Configurator, order code for "Enclosed accessories"

Field of Activities	Pressure measurement, powerful instruments for process pressure, differential pressure, level and flow:
	FA00004P
Technical Information	 TI00241F: EMC Test Procedures TI00426F: Weld-in adapters, process adapters and flanges (overview)
Operating Instructions	BA01271P
Brief Operating Instructions	KA01164P
Safety Instructions (XA)	Depending on the approval, the following Safety Instructions (XA) are supplied with the device. They are an integral part of the Operating Instructions.

Documentation

Option 1) Device Directive Documentation PMP21 ATEX II 1/2G Ex ia IIC T4 Ga/Gb XA01271P ΒA PMC21 ATEX II 2G Ex ia IIC T4 Gb XA01271P BΒ PMC21 ATEX II 3G Ex ec IIC T4 Gc XA01533P BC PMP21 PMC21 FM IS Cl. I, Div.1 Gr. A-D T4 XA01321P FA PMP21 PMC21 CSA C/US IS Cl. I Div. 1 Gr. A-D XA01322P CB PMP21 PMC21 EAC Ex ia IIC T4 Ga/Gb XA01540P GA PMP21 PMC21 IEC Ex ia IIC T4 Ga/Gb XA01271P IA PMP21 PMC21 NEPSI Ex ia IIC T4 XA01363P NA PMP21 TIIS Ex ia IIC T4 PMC21 ΤA In preparation PMP21

1) Product Configurator order code for "Approval"



The nameplate indicates the Safety Instructions (XA) that are relevant to the device.



www.addresses.endress.com

